

OREGON FUEL INJECTION, INC.


2003 – 2007 Dodge 5.9L Diesel Diagnostics

In order to do proper diagnostics you will need a scan tool and some special tools available from Miller Special Tools <http://millerspecialtools.spx.com> .

If you don't have service information you can buy a subscription online at alldatadiy.com or eAutorepair.net.

High Pressure Common Rail Basic Information


The high pressure pump builds the high pressure and delivers it to the fuel rail manifold where it flows through the injector lines and injector connector tubes to the injectors. The fuel pressure regulator (fuel control actuator) in the high pressure pump controls rail pressure. The injectors have a hollow check ball that holds rail pressure until the fuel solenoid is actuated by the ECM, this allows the check ball to rise off its' seat and an injection to take place. If the injector connector tubes, where they seat into the injectors, leak or the check ball in the injector is leaking or the high pressure limit valve then it will not build enough rail pressure to start the engine. It takes approximately 4000 PSI rail pressure for starting.

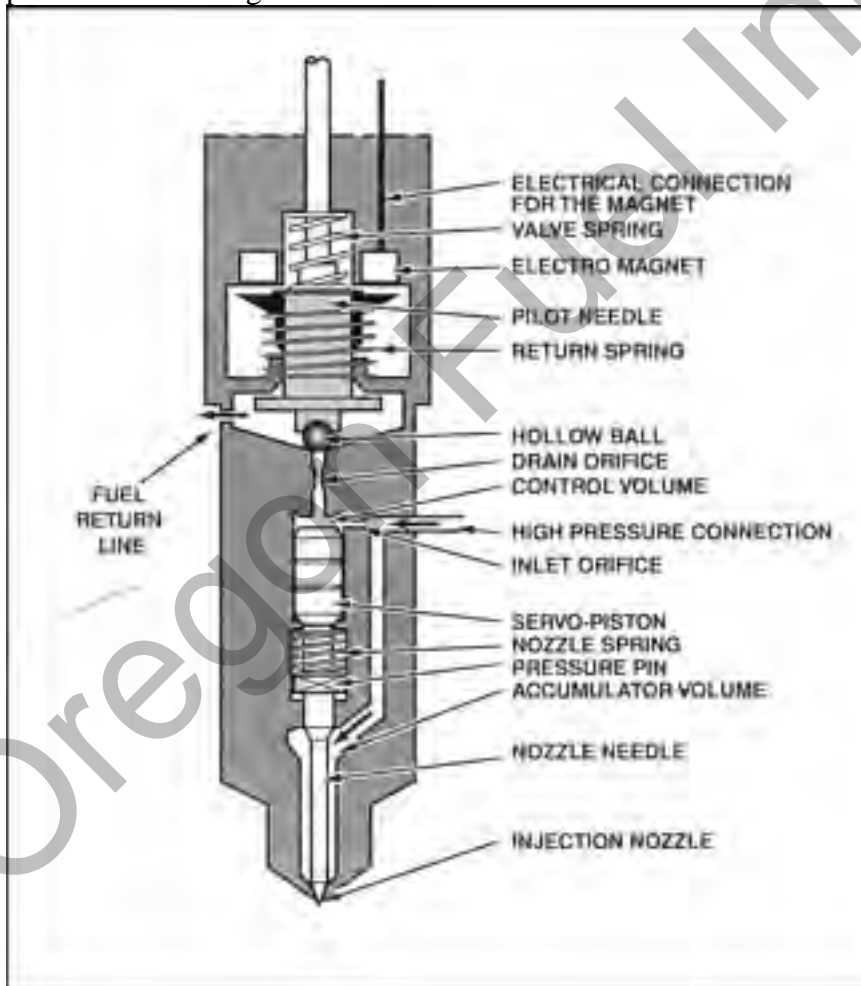

EUGENE
4036 West 1st Ave.
Eugene, OR 97402
(541) 485-1434
11/30/18



<https://oregonfuelinjection.com>

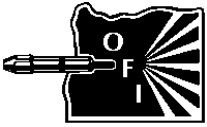

OREGON FUEL INJECTION, INC.

CAUTION

The fuel system contains high pressure fuel up to 25,000 PSI. Do Not use your fingers to find leaks! High pressure fuel entering your bloodstream may result in amputation or loss of life.

Preliminary checks

1. Record and repair any active DTC, they may be related to complaint
2. Ensure that you have a good clean fuel supply and good supply pressure.

No Start or Hard Start

1. No or low fuel supply to the high pressure injection pump (CP3)
2. Monitor rail pressure and see if you have over 4000 PSI during cranking, if not one or more injectors can cause a hard start, see injector section for further diagnostics. No smoke from the tailpipe after about 10 seconds of cranking means no fuel is getting into the cylinders. [Buy Dodge 5.9 CR Replacement Injectors](#)
3. Injector connector tube not seated in injector, bad tube or improper torque on nut. [Buy 5.9 Injector Connector Tube](#)
4. Leaking high pressure limit valve, should not leak at idle or during cranking. [Buy 5.9 Cummins Relief Valve](#)
5. Verify CP3 pump output volume (see high pressure pump info). You can also cap off all the injectors and see how quickly the rail pressure climbs. It takes about 4000 PSI rail pressure in order to start.
6. Shorted fan clutch, unplug fan and try starting again.

Black Smoke

1. If at idle, use the scan tool to cut out one cylinder at a time and see if the smoke disappears.
2. Dirty air filter
3. Exhaust leaks or Boost leaks, you can usually hear a boost leak as a high pitched squeal under load.

Miss

1. Use scan tool to isolate one cylinder at a time.
2. A bad or incorrect torque on an injector connector tube, missing or damaged chamber gasket, low compression or excessive valve lash could all cause a miss.


Knocks

1. Use scan tool to isolate one cylinder at a time
2. Use cap off tool 9011 to block off one injector at a time.

EUGENE
4036 West 1st Ave.
Eugene, OR 97402
(541) 485-1434
11/30/18



<https://oregonfuelinjection.com>

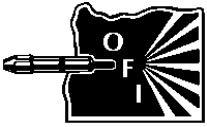

OREGON FUEL INJECTION, INC.

Surge at idle

1. Low or no fuel supply pump pressure to the high pressure pump
2. Actual versus desired too far apart, map the fuel pressure graph, may be a bad FCA (fuel control actuator). If you have a fluctuation over 500 PSI this can cause a surge. [Buy FCA for 5.9 Cummins](#)
3. Leaking relief valves may also cause a surge at idle and erratic rail pressure readings. [Buy Dodge Cummins Relief Valves](#)
4. Poor battery connections, bad batteries and/or battery cables.

Slow Deceleration

If the engine hangs at higher rpm or is slow to decelerate, injector wear is what normally causes this problem due to excessive return. Injectors will need to be replaced. [Buy Bosch 5.9 Replacement Injectors](#)

Blue-White smoke at idle when cold

If the smoke clears in less than 1 minute, this would be normal depending on temperature and altitude. Blue white smoke that burns your eyes, is un-burnt fuel, cold temperatures, high altitude and excessive idle time all mean cold combustion.

1. Possible bad injector, leaking at the nozzle tip. Use the scan tool to kill one injector at a time to isolate. However, this does not reduce rail pressure in the injector and the tip can still leak fuel. Cap off the rail one line at a time (cap is tool # 9011) to pinpoint injector.
2. The intake air temperature, coolant temperature, inlet air temperature and battery temperature should all display normal ambient temperatures when cold. If not, repair as necessary.
3. Check intake heater operation when cold.
4. Check rail pressure when engine is off, it should be 0 PSI (+/- 500 PSI).
5. Low or no supply pressure, supply pump or fuel filter etc.
6. Excessive idle time can cause white smoke when cold due to carbon build up on injector tips. More than 20% idle time is excessive.
7. Low compression in one or more cylinders.

Dilution

1. Upper injector o-ring
2. Cracked injector, remove valve cover and inspect for leaks while the engine is running. A leak will often look like a fog or haze of fuel.
3. Leak at the high pressure pump driveshaft seal.


Fuel Supply Pump

2003 and 2004 model years originally had the supply pump mounted on the fuel filter housing. There are replacement supply pumps for 2003 and 2004 that mount on the fuel filter housing, but have been updated to a different style. Some 2003-2004 trucks have

EUGENE
4036 West 1st Ave.
Eugene, OR 97402
(541) 485-1434
11/30/18



<https://oregonfuelinjection.com>

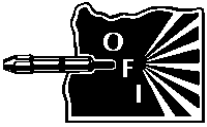

OREGON FUEL INJECTION, INC.

had the update done which places the lift pump in the tank. 2005 through 2007 5.9L had the supply pump mounted in the tank from the factory. There are also supply pumps that mount on the frame rail and replace the in tank supply pumps, such as the FASS pump and the BD Max-Flow pump. Test the supply pressure at the inlet to the CP3 pump. Normal pressure is 10 PSI at idle and they may drop close to zero PSI under load. Zero supply pump pressure will not damage the CP3 injection pump like it does to the earlier Bosch VP44 pump. [Buy FASS Fuel Supply Systems](#)

High Pressure Injection Pump (CP3 Pump) [Buy Bosch CP3 for 5.9 Cummins](#)

1. Most starting problems due to low pressure are caused by bad (leaking check ball seat) injectors. You can unplug the fuel control actuator and the pressure should default to maximum (23,500 PSI), however if there is a leak in the injection system then the pump can not build enough pressure. If there has been a major contamination issue with dirt and or water then it is very likely that the high pressure pump will need to be replaced. The injectors are typically damaged first, but any contamination that got into the injectors also went through the CP3 pump.
2. Volume test; the CP3 pump should discharge 70 ml (at 150 rpm or 90 ml at 200 rpm), from the CP3 to rail manifold fuel line, in 3 10 second cranking intervals (total of 30 seconds cranking). Remove the discharge line from the CP3 pump to test out put.
3. If the cascade over flow valve is bad this can send fuel out the return line instead of to the charging circuit of the CP3 pump, resulting in low rail pressure. [Buy 5.9 Cascade Overflow Valve](#)

Injectors [Buy Genuine Bosch Reman 5.9 Injectors](#)


It takes about 4000 PSI rail pressure in order for the injectors to deliver fuel for starting.

1. Maximum allowable leakage for all injectors combined is 160 ml per minute: check when coolant temperature is above 180 degrees, 1200 rpm and fuel rail pressure is equal to 20,305 PSI.
2. Any injector contributing more than 40 ml is excessive. IE: if total leakage is 200 ml and blocking off number one injector reduces the total leakage to 160 ml, cylinder number one injector has excessive leakage and is bad.
3. If you have a no start condition, maximum allowable return is 90 ml per minute at 200 rpm cranking speed, be careful not to over heat the starter during testing.
4. Damaged or loose high pressure injector connectors can cause excessive leakage.
5. Excessive leakage usually results in a starting issue, which could occur hot or cold, but usually occurs hot because the fuel is thinner when hot.

EUGENE
4036 West 1st Ave.
Eugene, OR 97402
(541) 485-1434
11/30/18



<https://oregonfuelinjection.com>

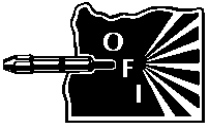

OREGON FUEL INJECTION, INC.

Use the following information regarding diagnostic trouble codes in addition to the normal diagnostic procedures outlined in the service manual or technical service bulletins.

DTC P0148; high pressure common rail checksum, this is a deviation between the fuel pressure set point and the actual fuel pressure.

1. FCA, check for rust on the fuel control actuator, which could indicate other fuel system problems caused by water contamination.
2. Fuel pressure sensor
3. Lift pump or fuel supply issues, check fuel supply pressure and fuel filter condition.
4. Cascade over flow valve
5. Pressure limit valve leaking out return
6. Injectors, excessive return, see injectors
7. High pressure pump (CP3)

DTC P0201 – P0206 Injector control circuit

1. Pass through connectors open
2. Check injector resistance, should be less than 1 ohm and greater than zero ohms (zero ohm meter leads before test).

DTC P0300 – P0306; injector misfire, all and 1 through 6

1. Low fuel supply pressure
2. Use scan tool to isolate each cylinder
3. Check contribution rates of each injector

DTC P0217; decreased performance due to an overheat condition


1. Check ECT sensor
2. Restricted air flow (caked dirt and bugs) through the intercooler and radiator.

DTC P0251; CP3 pump regulator control, ECM detects a discrepancy between PWM signal supplied to FCA and the PWM returned from FCA

1. Low or no fuel supply pressure (bad supply pump or plugged filter)
2. Fuel Control Actuator (FCA) bad, use the scan tool to verify rail pressure set point versus fuel pressure. Normal idle pressure is 6000 – 7000 PSI. If you have a fluctuation over 500 PSI this can cause a surge as well.

DTC P0336; crank position sensor (CKP) signal, CLP below calibrated value

1. Excessive cranking with a no start condition
2. CKP sensor
3. CKP wiring issue

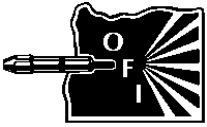

OREGON FUEL INJECTION, INC.

DTC P0483; Fan Speed

- Often sets in conjunction with P0480
- 1. Inspect the fan clutch wiring and connector for damage
- 2. Ground the Brown/Orange wire at the fan clutch connector ('04.5+). The fan should slowly start to spin faster. This may take 30 seconds or more.
- 3. Verify that there is 12 volts on the Gray/Pink wire. If the wire has 12 volts and grounding the Brown/Orange wire does not make the fan engage, the fan clutch is faulty.
- 4. Fan speed should be close to engine RPM when engaged and read with a scan tool.

DTC P1222; Leak Detection During Motoring

- When the fault occurs, the "Wait to Start" lamp will turn on and a chime will sound 10 times. "Motoring" is when the engine is running, but requires no fuel injection (coasting with foot off the throttle).
- 1. Check for other fuel system related codes. If there is any, address them first.
- 2. If not, perform the checks outlined under P0148 and Injectors above.

DTC P1223; Leak Detection Based on Quantity Balance

- When the fault occurs, the "Wait to Start" lamp will turn on and a chime will sound 10 times. The ECM sets this code when calculated fuel flow exceeds an expected value. An engine derate is enabled when the fault sets, and will automatically return to normal when the fault is not detected.
- 1. Check for other fuel system related codes. If there is any, address them first.
- 2. If not, perform the checks outlined under P0148 and Injectors above.

DTC P2146; bank 1 (cylinders 1-3) shorted high or low

1. Check injector wire harness, valve cover gasket and injectors. Resistance should be less than 1 ohm and greater than 0 ohms (zero ohm meter before testing)

DTC P2149; bank 2 (cylinders 4-6) shorted high or low

1. Check injector wire harness, valve cover gasket and injectors. Resistance should be less than 1 ohm and greater than 0 ohms (zero ohm meter before testing)

DTC P2509; Power down data lost error

- Essentially a low battery voltage code.
- 1. Check batteries, battery cables, and battery connections. Any amount of corrosion or loose connections will cause this code to set.